

Courtney Wilton, Portland Public Schools Lead Paint Condition Assessment, Wilson High School April 20, 2017 Page 2 of 2

Painted playground and parking lot striping and curbing often contain lead and are generally in deteriorated condition due to weatherization and traffic. PBS did not assess this paint, but recommends restriping, as needed, to maintain in intact condition.



### Wilson High School Assessment of Paint/Varnish in Deteriorated Condition

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
А	Exterior	Faculty 145	Wall under windows (paint chips)	Below	No	Concrete	20
В	Exterior	West building entrance near faculty 145	Handrails	Below	No	Metal	20
С	Exterior	West building entrance near faculty 145	Posts	Below	No	Metal	15
D	Exterior	Southwest gym entrance	Handrails and posts	Below	No	Metal	20
Е	Exterior	South side of pool area	Wall	Above and below	No	Concrete	160
F	Exterior	Press box east door frame	Door frame	Above and below	No	Metal	15
G	Exterior	Northeast corner of pool area	Wall and handrail	Above and below	No	Concrete and metal	150
Н	Exterior	North gym entrance	Posts	Below	No	Concrete	10
Ι	Exterior	North gym exterior	Wall (paint chips)	Below	No	Concrete	50
J	Exterior	North building entrance	Wall under brick	Below	No	Concrete	40
к	Exterior	East exterior of boiler room	Wall under brick	Below	No	Concrete	40
L	Exterior	Loading dock	Walls and handrails	Below	No	Concrete and metal	200
М	Exterior	Vestibule	Guard rail supports and ceiling trim	Above and below	No	Concrete and metal	90
Ν	Exterior	Entrance near classroom 29	Supports	Above and below	No	Metal	20
0	Exterior	Entrance to room north of cafeteria	Posts	Below	No	Metal	10
Ρ	Exterior	East exterior of drafting/photographic arts	Wall (paint chips) and trim	Below	No	Concrete	100
Q	Exterior	South exterior of drafting/photographic arts	Wall and trim (paint chips)	Below	No	Concrete	80
R	Exterior	Building entrance near photo arts	Supports	Above and below	No	Metal	20
S	Exterior	Southeast auditorium entrance	Wall	Below	No	Concrete	60
Т	Exterior	Baseball field	Underside of bleachers	Above and below	No	Metal	800
U	Exterior	Baseball field	Press box window assemblies	Above and below	No	Wood	25
V	Exterior	Baseball field	Northeast dugout trim	Above	No	Wood	40

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
W	Exterior	Baseball field	Southwest dugout trim	Above	No	Wood	40
Х	Exterior	Baseball field	Concessions door	Above and below	No	Metal	45
Y	Exterior	Home grandstand	Handrails around track	Below	No	Metal	200
Z	Interior	Boiler room	Handrails and cat walk	Above and below	No	Metal	300
AA	Interior	Boiler room	Tank doors	Above and below	No	Metal	90
AB	Interior	Custodial lunch room	Floor	Below	No	Concrete	350
AC	Interior	Custodial lunch room	Built-in cabinets	Above and below	No	Wood	80
AD	Interior	Boiler custodial	Floor	Below	No	Concrete	220
Æ	Interior	Boiler custodial	Pipes	Above and below	No	Metal	40
AF	Interior	Custodial	Door	Above and below	No	Wood	45
AG	Interior	Custodial	Door	Above and below	No	Wood	45
AH	Interior	Boy's restroom 23	Door and frame	Above and below	No	Wood	60
A	Interior	Kitchen	East serving line doors	Above and below	No	Wood	90
AJ	Interior	Kitchen food storage	Door and frame	Above and below	No	Wood	60
AK	Interior	Kitchen office door	Door	Above and below	No	Wood	45
AL	Interior	Cafeteria	South dish return door frame	Above and below	No	Wood	15
AM	Interior	Mechanical room south of cafeteria	Doors	Above and below	No	Wood	90
AN	Interior	Metal 15	Doors	Above and below	No	Wood	225
AO	Interior	Wood work 9	Doors	Above and below	No	Wood	315
AP	Interior	Wood work 9	Wall nest to south entrance	Above and below	No	Concrete	25
AQ	Interior	Custodial 10	Door	Above and below	No	Wood	45
AR	Interior	Drafting 8	Built-in cabinets	Above and below	No	Wood	85
AS	Interior	Robotics	Door	Above and below	No	Wood	45

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
AT	Interior	Faculty men 4	Door	Above and below	No	Wood	45
AU	Interior	Industrial education lab	Door	Above and below	No	Wood	45
AV	Interior	Office work room	Built-in cabinets	Below	No	Wood	20
AW	Interior	Stage entrance by office	Door	Above and below	No	Wood	90
AX	Interior	Vice principals work room	Floor	Below	No	Concrete	100
AY	Interior	East gym entrance	Door	Above and below	No	Wood	360
AZ	Interior	Stairwell to roof east of gym	Walls	Above and below	No	Concrete	160
BA	Interior	Sprinkler room across from 2nd floor elevator	Walls	Above and below	No	Concrete	80
BB	Interior	Boy's room 231	Door	Above and below	No	Wood	90
BC	Interior	Custodial 230	Door	Above and below	No	Wood	45
BD	Interior	Girl's room 228	Doors	Above and below	No	Wood	90
BE	Interior	Classroom 227	Door	Above and below	No	Wood	45
BF	Interior	Textbook drop 243	Door	Above and below	No	Wood	45
BG	Interior	Library 244	Doors	Above and below	No	Wood	90
BH	Interior	Crafts 248	Built-in cabinets	Above and below	No	Wood and concrete	40
BI	Interior	Crafts 248	Door	Above and below	No	Wood	45
BJ	Interior	Classroom 247	Built-in cabinets	Above and below	No	Wood	70
BK	Interior	Classroom 246	Built-in cabinets	Above and below	No	Wood	70
BL	Interior	Classroom 209	Door and frame	Above and below	No	Wood	60
BM	Interior	Classroom 210	Door	Above and below	No	Wood	45
BN	Interior	Classroom 211	Walls (paint chips)	Above and below	No	Concrete	80
BO	Interior	Classroom 213	Door and frame	Above and below	No	Wood	60
BP	Interior	Classroom 214	Built-in cabinets	Above and below	No	Wood	75

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
BQ	Interior	Classroom 215	Door	Above and below	No	Wood	45
BR	Interior	Boy's room 216	Door	Above and below	No	Wood	45
BS	Interior	Custodial 217	Door	Above and below	No	Wood	45
BT	Interior	Faculty women's 218	Door	Above and below	No	Wood	45
BU	Interior	Classroom 223	Wall near entrance	Below	No	Concrete	25
BV	Interior	Classroom 223	Door	Above and below	No	Wood	45

ID Interior / Exterior

Location

Structure

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
DK	Interior	Classroom 137	Door and built-in cabinets	Above and below	No	Wood	65
DL	Interior	Classroom 127	Door and built-in cabinets	Above and below	No	Wood	65
DM	Interior	Classroom 136	South wall	Below	No	Drywall	20
DN	Interior	Classroom 136	Door	Above and below	No	Wood	45
DO	Interior	Classroom 128	Door	Above and below	No	Wood	45
DP	Interior	Classroom 129	Door and built-in cabinets	Above and below	No	Wood	65
DQ	Interior	Classroom 134	Door and built-in cabinets	Above and below	No	Wood	65
DR	Interior	Classroom 134	South wall	Below	No	Drywall	20
DS	Interior	Classroom 130	Door and built-in cabinets	Above and below	No	Wood	65
DT	Interior	Classroom 133	Door and built-in cabinets	Above and below	No	Wood	65
DU	Interior	Classroom 131	West wall	Below	No	Drywall	5
DV	Interior	Classroom 131	Door	Above and below	No	Wood	45
DW	Interior	Classroom 132	West door	Above and below	No	Wood	45
DX	Interior	Custodial Room 124	Door	Above and below	No	Wood	45
DY	Interior	Girl's Room 122	Doors	Above and below	No	Wood	90
DZ	Interior	Athletic director 121	Doors x3	Above and below	No	Wood	135
EA	Interior	Classroom 120	Door	Above and below	No	Wood	45
EB	Interior	Classroom 119	Door and built-in cabinets	Above and below	No	Wood	75
EC	Interior	Classroom 142	Door and built-in cabinets	Above and below	No	Wood	75
ED	Interior	Classroom 117	Door and built-in cabinets	Above and below	No	Wood	65
EE	Interior	Classroom 143	Door and built-in cabinets	Above and below	No	Wood	65
EF	Interior	Classroom 118	Door and built-in cabinets	Above and below	No	Wood	65
EG	Interior	Classroom 144	Door and built-in cabinets	Above and below	No	Wood	65

ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
EH	Interior	Classroom 116	Door and built-in cabinets	Above and below	No	Wood	65
EI	Interior	Teachers offices 115	Doors	Above and below	No	Wood	135
EJ	Interior	Faculty 145	Door	Above and below	No	Wood	45


Above and below


DEIOW

Above and


below087 545 TDEast d27740l33west1 TD/bel)Tjbove and below below


ID	Interior / Exterior	Location	Structure	Above / Below five feet	K-2nd Grade	Substrate	Square Feet
FE	Interior	Boy's team Room C	Floor	Below	No	Concrete	500
FF	Interior	Boy's team Room D	Floor	Below	No	Concrete	100
FG	Interior	Boy's locker room	Floor	Below	No	Concrete	2500
FH	Interior	East boy's locker room entrance	Doors	Above and below	No	Metal	90
FI	Interior	Room 38	South wall	Above and below	No	Drywall	80
FJ	Interior	Room 38	Door	Above and below	No	Wood	45
FK	Interior	Apparatus room	Doors	Above and below	No	Wood	90
FL	Interior	Team Room E	Floor	Below	No	Concrete	200
FM	Interior	Girl's locker room custodial	Door	Above and below	No	Wood	45
FN	Interior	Girl's locker room office	Door	Above and below	No	Wood	45
FO	Interior	Girl's locker room north storage	Door	Above and below	No	Wood	45
FP	Interior	Equipment issue girl's locker room	Walls and ceiling	Above and below	No	Drywall	40
FQ	Interior	Girl's locker room south storage	Walls and ceiling	Above and below	No	Drywall	20
FR	Interior	Girl's locker room floor	Floor	Below	No	Concrete	2500

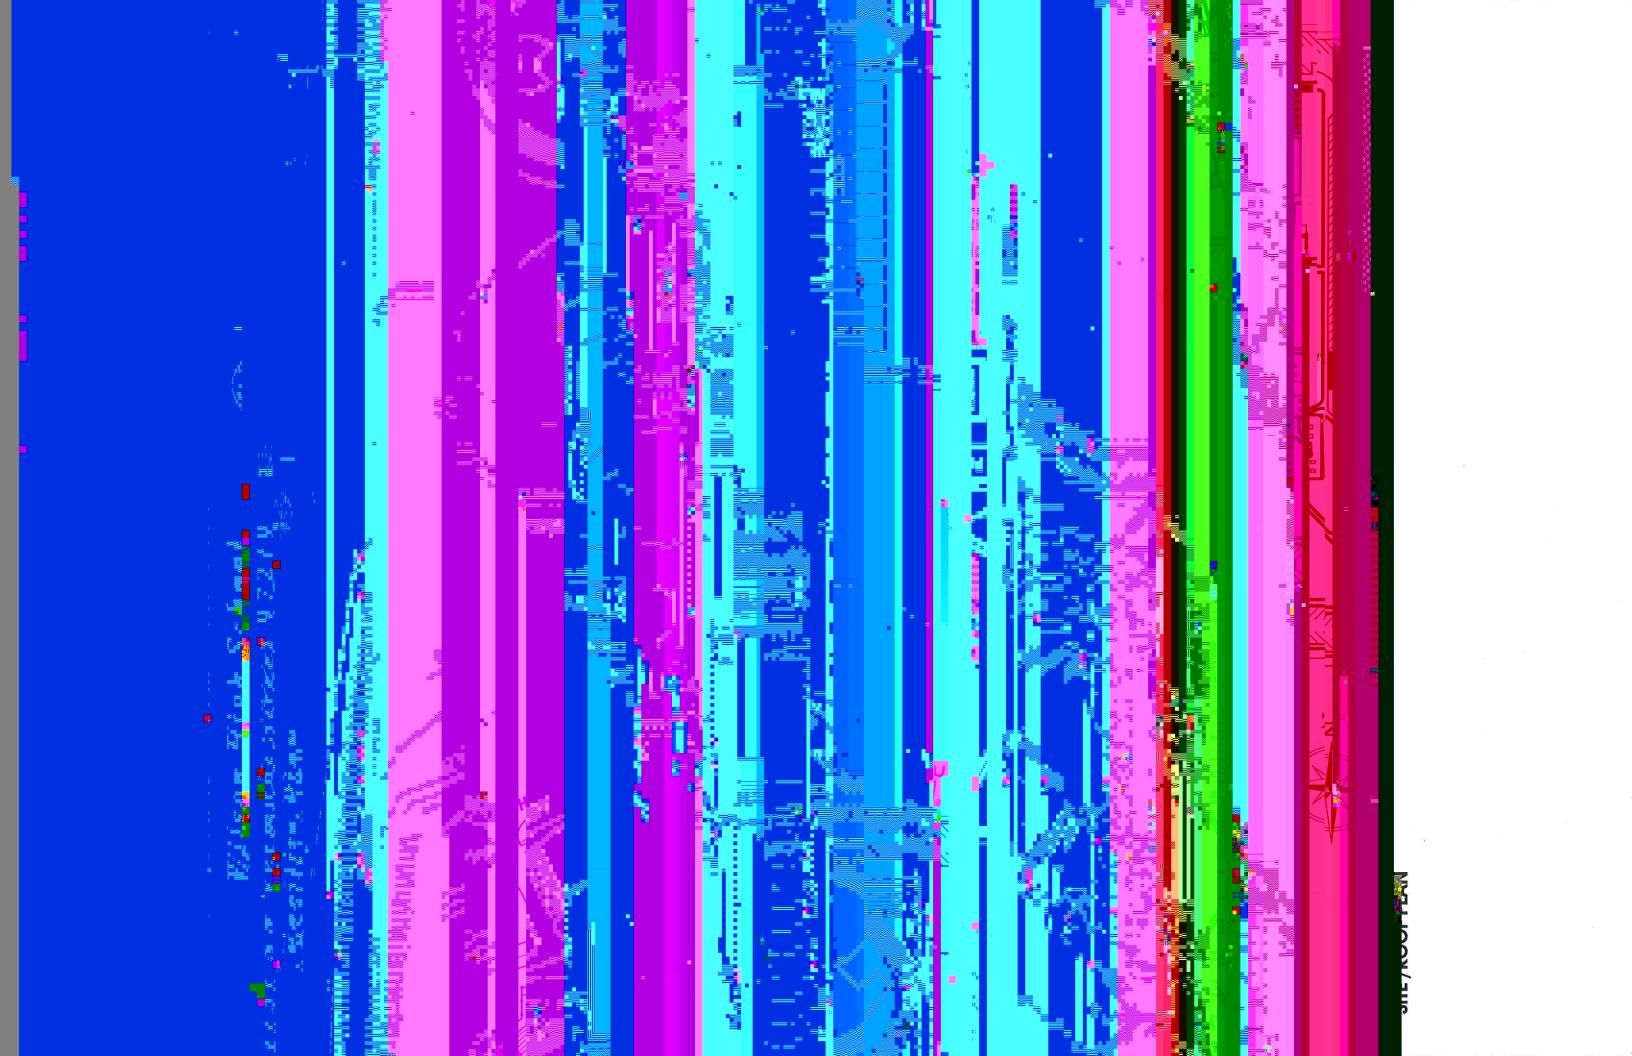

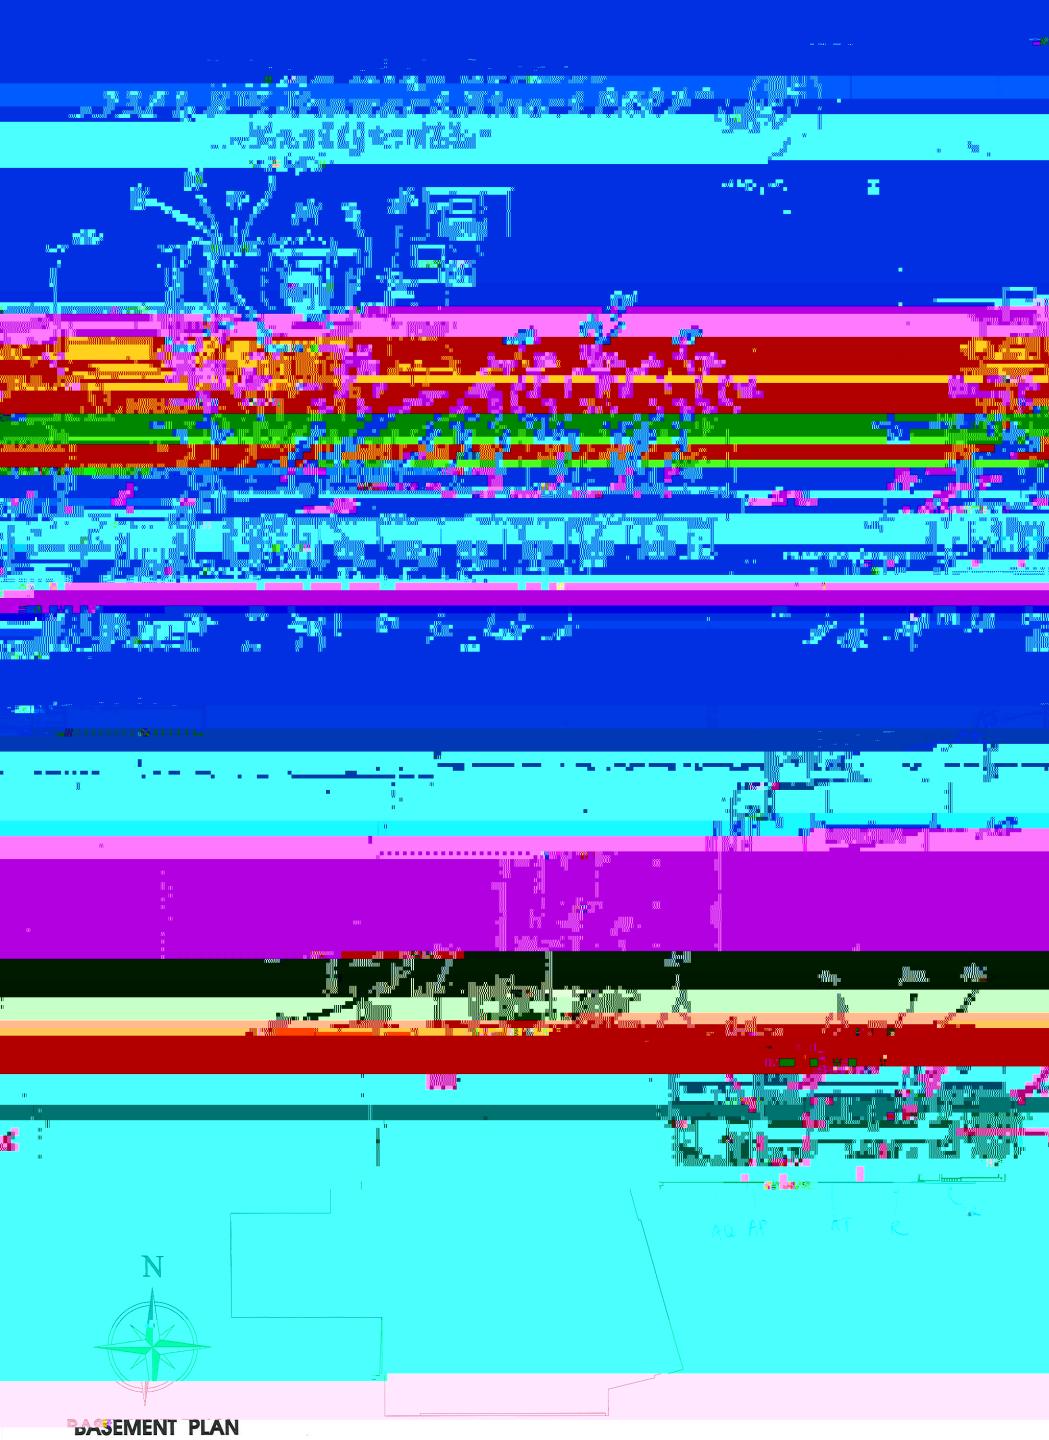





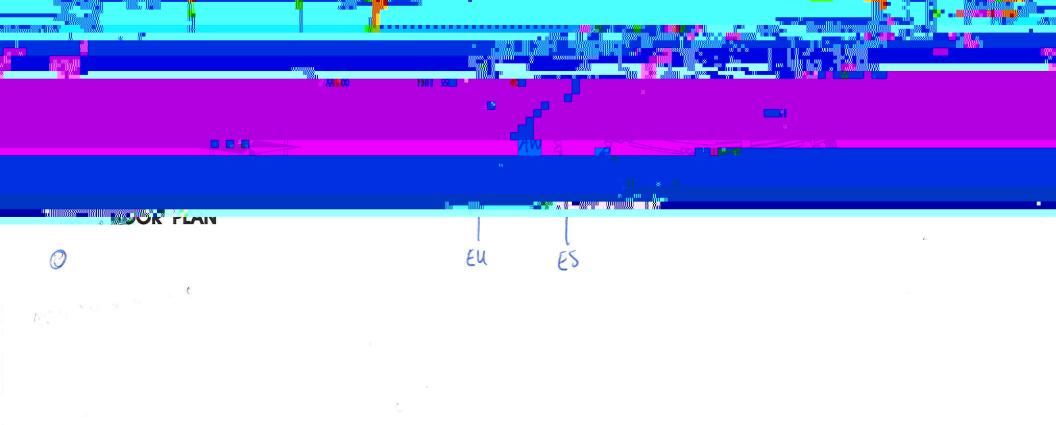

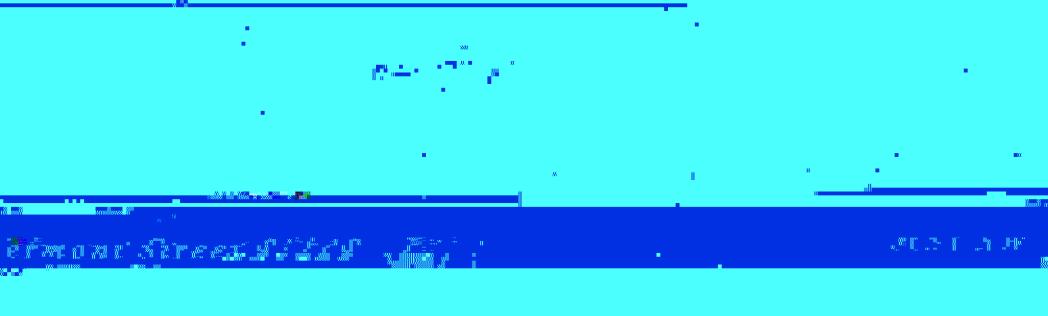

# K H</t

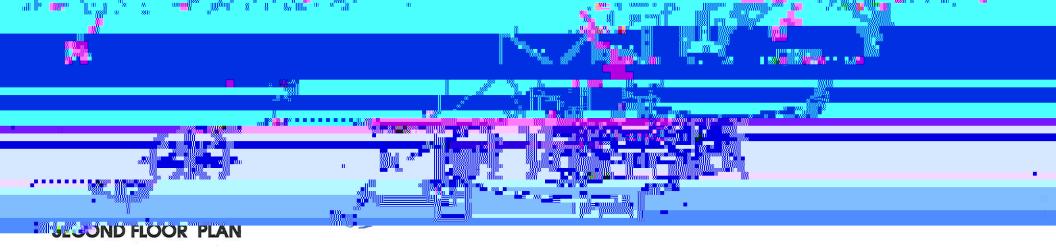

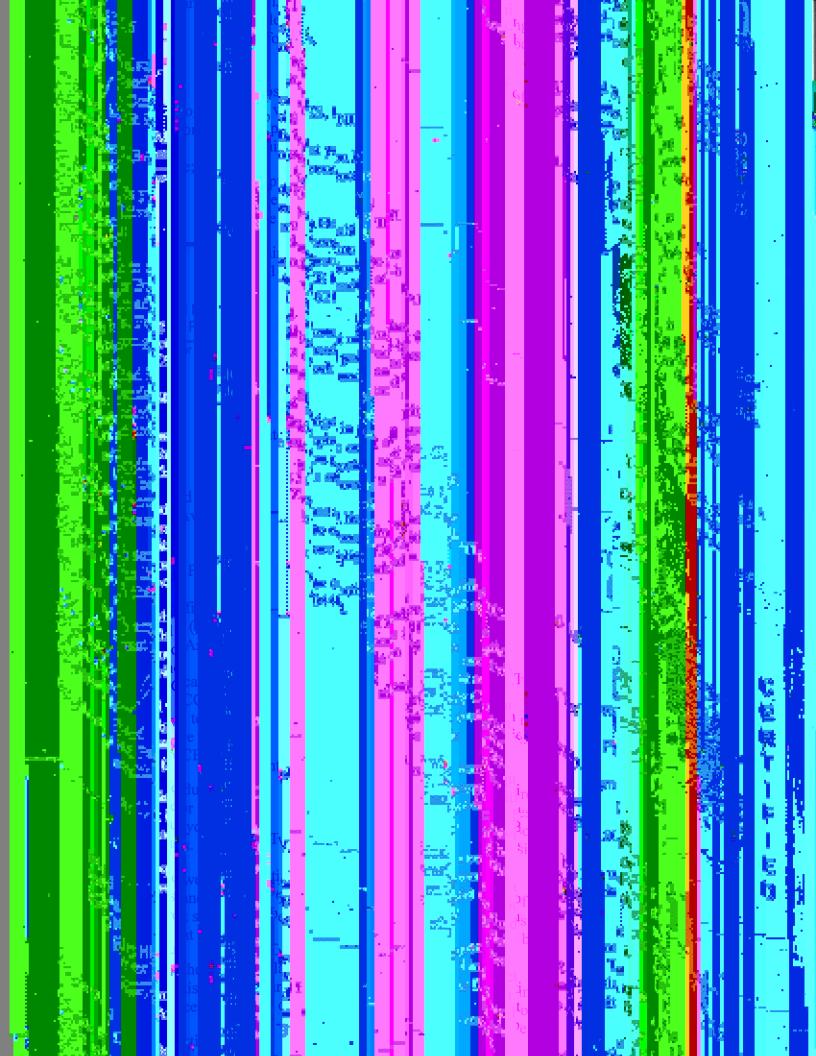

State of Oregon Oregon Health Authority

### Clark R. Nelson


is certified by the Oregon Health Authority to conduct Lead-Based Paint Activities

### **Risk Assessor**

Certification Number: Issuance Date: Expiration Date: 1806--Indv--R 6/9/2016 6/30/2017





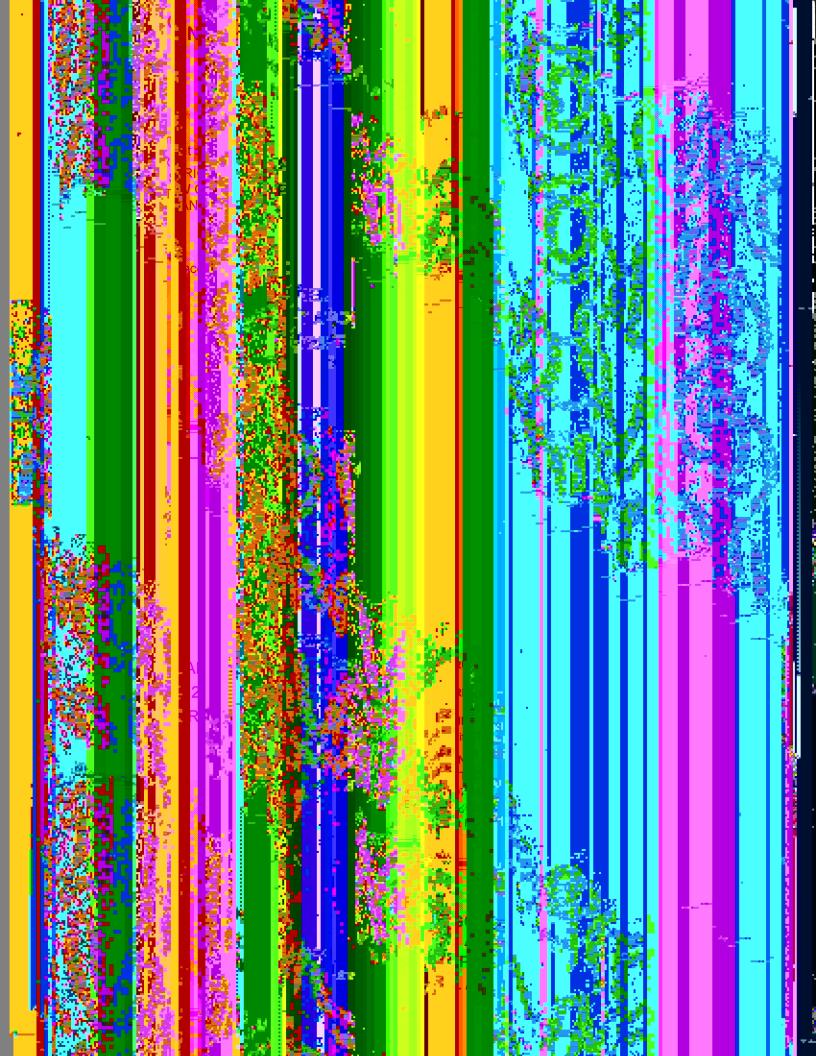

	152416178816 TB TB TB 11	TE MARCHARD	
- [- 5] - 5 - 50 - 			
		· · · · · · · · · · · · · · · · · · ·	-** ·
			- <b>x</b>
	<u>37 37 001(</u>	on water and the state of the s	
Dengan banda bahar sebarah dari sebarah dari sebarah dari sebarah dari sebarah dari sebarah dari sebarah dari IN-2015 pendambahar dari sebarah d IN-2015 pendambahar dari sebarah d		Dartland OP 07232	
Sules Needers		Portland, OR 97232	-
			· · · · · ·
η αλ. τοτ η σ	NAME AND A CONTRACT OF A CONTRACT.		
		The second statement of	
	Attention: Derek May		
se compression de la sur seus	and a contraction of the		
	n selen en fan de f En selen ei je fan de fan d En selen ei je fan de fan d		
	er 1914 werden van die sonder verste Bernen die Stander van die ster die Bernen van die ster die ster die ster Naam werde ster die st	in a contraction of the bor mat	yonnan
e en el Segundadore el conservação	if the second design of the	Dales to it Br 232 169 to pondoor land house	
and the second	. Other and a swame we are the fair of the second states and the s		
		<u></u>	erekeurt Stevenski (steve
	paint availates in siegen		
	In addition to certification by the Oregon Health Author	rity (Authority), PBS Engineering and	•
	Environmental Inc. is required to be licensed by the Co	nstruction Contractors Board (CCB) prior to	2. 445
	AAB ALWART FRANT TOTAL BART WATER THE APPOINT THE	TANK TO THE TOTAL STATE OF THE SECOND STATE OF	
			·····
	<u>Narnan ana ana ana ana ana ana ana ana an</u>	il Manual Bar Bar Bar Control Control Control Control	
Late Province Conversion	503-378-4621.		
			2
	As a firm certified to conduct lead-based paint inspecti	on activities in Oregon, PBS Engineering and	
<b>Privinensia</b> li	The low atthe are attracted as winners at for	DAD 222 060 It must comply with	X MARET J
			<u> </u>
k konstrukturen er en		antificat in dividuals to wanduat vanilated	-
En legitoria		Construction of the second	
	activities.		
and a state of the second s	and a stand when a stand of the	manaforming load based paint activities in	, a second contractor
<u> </u>	n an	<u>, e l'an an a</u>	·
	Togun. The list is also realized or the realized of the second second second second second second second second		
	Burn funt that measurating by the state and aligible to	he on this list	- ···· -· -: -: -: -: -: -: -: -: -: -: -: -: -:
1 <u>0</u> 1965-02-011-06-05-02-02- 1	H MUHATU, FARANSKI STOLE HALL AN		
En a la la Carecara ada	and have been a set of the set of	an other expects of the Load Decad Doint	
in a confidence and	19 1001.31000.01 (2003.2200) 12. UNIT VERLIVERVERVERVERVERVERVERVERVERVERVERVERVERV		· · · · · ·
Drayrora nian	in nontant monoram state at 18634 f is 6 12 2222		
้อการราชการ		، ۲۰۰۰ ۲۰۰۰ ۲۰۰۰ ۲۰۰۰ ۲۰۰۰ ۲۰۰۰ ۲۰۰۰ ۲۰	
	"Du Myn		
	Ron Mounard		

Ben Maynard Lood Based Paint Program

## State of Oregon Oregon Health Authority

# PBS En gineering and Environmental Inc.

### is certified by the Or

egon Health Authority to conduct Lead-Based Paint Activities

Cert Issu: fication Number: Date ince Date: of Expiration:

1038--LBP FIRM 5/16/2016 6/30/2017





